

*Inj*ectronics

TECHNICAL BULLETIN

FORD – FALCON – BA

#T0113

Make: Ford

Model: Falcon BA 4.0L

Subject: No tiptronic function

TEST: Road test vehicle, the automatic transmission will shift normally in drive but there is no tiptronic function. Listen for a buzzing noise from the transmission in Park & Neutral? (Variable pressure solenoid) The quadrant light in instrument cluster always shows the transmission in drive.

PCM has logged a selector range switch fault.

FAULT: There was a broken wire in the harness under ABS module (CAN Network).

The instrument cluster should indicate PRNDL at KOEO.