

Injectronics

TECHNICAL BULLETIN

DAEWOO - CIELO

#T0076


Make: Daewoo

Model: Cielo 1.5L 1994-1995

Subject: No start

Injectronics has recently had a number of calls on the Daewoo Cielo 1.5L for a no start situation, after further investigation it was found that this was generally occurring after the head gasket had been done on the vehicle.

The problem was traced back to the coolant temp sensor and the distributor, they sit beside each other on the vehicle, both have identically shaped pin plugs, if the plugs are swapped around the vehicle will not start. The easy solution is swap the plugs back around, generally no damage occurs to the engine ECU, if any further problems occur the ECU can be tested by Injectronics.

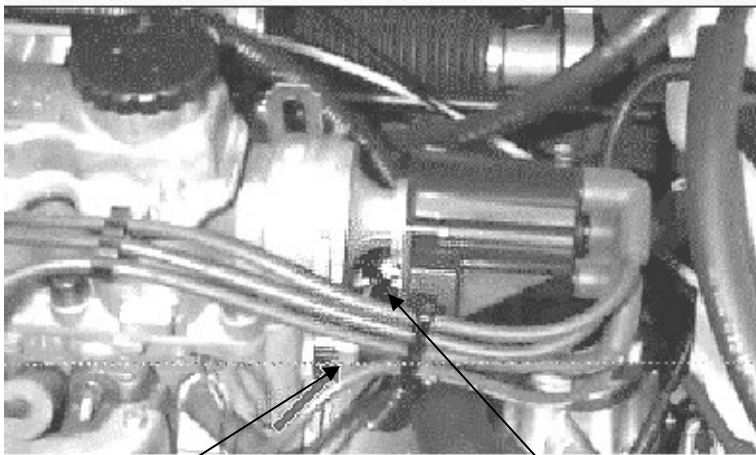

Coolant sensor plug

Distributor plug